


Standard Plain Weave



Warp / Shute Contour:

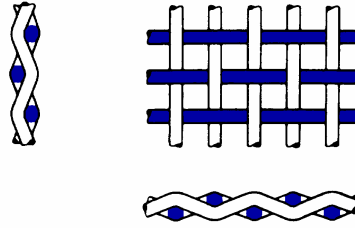

Bronze

No. of warp wires [cm]	no. of shute wires [cm]	warp dia. [mm]	shute dia. [mm]	mesh opening warp [mm]	mesh opening shute [mm]	open area [%]	weight [kg/m ²]	Air Permeability [cfm]
2	2	1,00	1,00	4,00	4,00	64,00	2,765	2250
3	3	0,85	0,85	2,48	2,48	55,50	2,996	1980
5	5	0,60	0,60	1,40	1,40	49,66	2,488	1870
7	7	0,38	0,38	1,05	1,05	53,88	1,397	2110
7	7	0,45	0,50	0,98	0,93	44,53	2,189	1680
9	10	0,35	0,35	0,76	0,65	44,53	1,609	1870
12	12	0,31	0,31	0,52	0,52	39,44	1,594	1420
14	14	0,26	0,26	0,45	0,45	40,45	1,308	1490
16	15	0,30	0,30	0,32	0,37	28,60	1,928	1050
18	16	0,28	0,29	0,28	0,34	26,59	1,905	1070
20	17	0,26	0,28	0,24	0,31	25,15	1,856	920
28	19	0,21	0,23	0,15	0,30	23,20	1,548	793
32	24	0,17	0,18	0,14	0,23	25,90	1,177	798

annealed or non-annealed !

Siebfabrik
Arthur Maurer GmbH + Co. KG

Mühlberg 50 (Öschingen)
D-72116 Mössingen

Telefon +49 7473/9475-0
Telefax +49 7473/9475-50

e-mail: info@siebfabrik.com